
## A Watershed Conditions Report For the State of Kansas HUC 10240007 (South Fork Big Nemaha) Watershed



Kansas Department of Health & Environment Bureau of Water Watershed Management Section 1000 SW Jackson Topeka, KS 66612

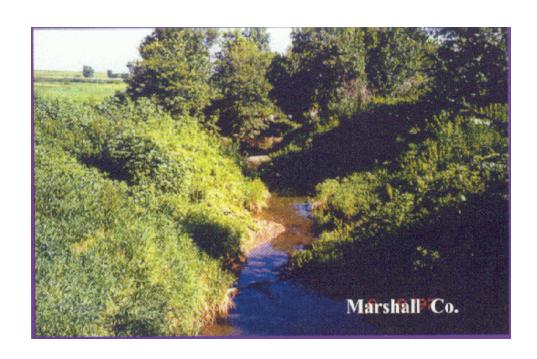

# Watershed Conditions Report For HUC 8 10240007 (South Fork Big Nemaha)

Prepared by
Kansas Department of Health and Environment (KDHE)
Nonpoint Source Section
12/28/00

#### **EXECUTIVE SUMMARY**

This Watershed Conditions Report is designed to serve as a water quality "atlas", and is intended to provide stakeholders in water quality with a tool to assess the condition of water resources within their watershed. Surface water quality for HUC 8 10240007 streams and rivers is generally poor with over half of the stream and river segments sample not meeting their designated uses. The primary pollutant concern for the HUC 8 10240007 watershed is fecal coliform bacteria (FCB) and insufficient water flow. FCB is found in the digestive systems of warm blooded animals. In the environmental coliform bacteria is an indicator of potential disease producing organisms. Insufficient flow can cause the stream to have a high temperature, low dissolved oxygen, and increase pollutant concentrations.

There are several small city and county lakes within HUC 8 10240007. The primary pollutant concern for lakes/wetlands in this watershed is insufficient flow of water. Insufficient flow occurs when a lack of water enters the lake causing high temperatures, low levels of dissolved oxygen, and increase pollutant concentrations.

Groundwater resources in HUC 8 10240007 include alluvial aquifers of the Big Nemaha River and it's tributaries and Glacial aquifers. Water from these aquifers is generally in good condition with naturally occurring minerals and nitrate as the primary pollutant concerns.

#### **PURPOSE**

The Watershed Conditions Report is designed to serve as a water quality "atlas" for a given watershed, and is intended to provide Watershed Stakeholders Committees (WSC) with a tool to assess the condition of water resources within their watershed.

#### BACKGROUND

The Clean Water Act mandates that States assess the quality of their waters and implement Total Maximum Daily Loads (TMDLs) for water bodies that do not meet their designated uses. The following is a summary of steps taken by the State of Kansas to comply with these requirements of the Clean Water Act.

The Kansas Department of Health and Environment (KDHE) prepared the Kansas Unified Watershed Assessment in 1998. This assessment classifies the State's watersheds into four categories. A Category I classification means the watershed is in need of restoration due to having water quality impairments or degradation of other natural resources related to an aquatic habitat, ecosystem health and other factors related to aquatic life resources. Category II watersheds are in need of protection. Category III are watersheds with pristine or sensitive aquatic system conditions on lands administered by federal, state, or tribal governments. Category IV watersheds are those for which there is insufficient data to make accurate classification. KDHE has assigned a restoration priority score to each Category I watershed.

As mandated by section 303(d) of the Clean Water Act, lakes and streams within the Category I watersheds, which do not meet water quality standards, are published biannually in the 303(d) list. Subsequently, lakes and streams which appear on the 303 (d) list are scheduled to have a Total Maximum Daily Load (TMDL) prepared. KDHE is currently preparing TMDLs for impaired stream segments located within the highest restoration priority watersheds.

To restore water quality within the Category I watersheds, KDHE recommends the implementation of a Watershed Restoration and Protection Strategy (WRAPS). The ultimate goal of the WRAPS process is to create and implement a plan to restore the health of water bodies that do not meet their water quality standards. Additionally, the WRAPS process will insure that water bodies that currently meet their water quality standards are protected.

KDHE recommends that the WRAPS process be implemented on a local level by a Watershed Stakeholders Committee (WSC). The WSC would have the responsibility of working with local and state agencies to develop a WRAPS plan. This plan should identify the following: public outreach methods; required monitoring activities based on water quality goals and outcomes; specific water quality problems; watershed coordinator/evaluator; actions to be taken to achieve water quality goals and outcomes; schedule for implementation of needed restoration measures; and funding needs.

#### **Streams and Rivers**

#### HUC 8 10240007


The Huc 8 10240007 watershed is ranked ninth in priority for watershed restoration throughout the state. According to the Unified Watershed Assessment, 85% of the total miles of water in this watershed do not meet their designated uses. This watershed has several small creeks and streams which primarily drain into the Big Nemaha River. See Attachment 1 for a map of streams and rivers in HUC 8 10240007.

#### **Designated Uses**

There are approximately 134 public water supplies within the watershed, many of which draw water from the many streams and creeks. According to the Kansas Surface Water Register, the most common designated uses for streams and rivers in this watershed include: expected aquatic life uses, food procurement; recreation, and domestic water supply.

Figure 1

#### **Surface Water Uses**

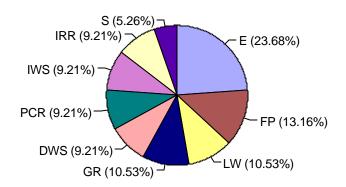

pE=Expected Aquatic Life Use Water

pFP=Food Procurement

pDWS=Designated for domestic water supply use.

**p**GR=Designated for ground water recharge.

pLW=Designated for livestock watering use.

pIRR=Designated for irrigation use.

pIWS=Designated for Industrial Water Supply

pPCR=Designated for Contact Recreation

pS=Special Aquatic Life Use


#### **TMDL/Contaminate Concerns**

Streams and rivers throughout Kansas have been sub-divided into segments. By dividing the streams and rivers into segments they can be better analyzed and understood. A reach of river or stream may have segments which vary greatly in water quality, based on surrounding land uses. The figures below display the impairments of the streams and rivers based on the number of segments sampled.


Surface waters not meeting their designated uses will require total maximum daily loads (TMDLs). Approximately 65% of the stream and river segments sampled in this watershed require TMDLs (Figure 2). As shown below, the primary pollutant concerns for this watershed are fecal coliform bacteria (FCB) and insufficient flow (hydro) as seen in Figure 3. Approximately 93% of the segments sampled are impaired by FCB and 7% are impaired by insufficient flow.

Fecal Coliform Bacteria (FCB) is a bacteria present in human and animal waste. It serves as an indicator of potential disease causing organisms. Insufficient flow can cause the stream to have high temperatures, low dissolved oxygen, and increased pollutant concentrations.

Figure 2 Figure 3

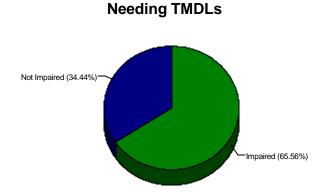

Percentage of Stream/River Segments

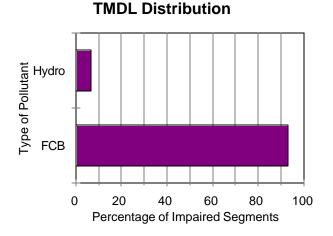

#### **Potential Pollution Sources**

Potential sources of FCB contamination include feedlots, wastewater treatment facilities, septic systems, and wildlife.

Analyzing the land uses within this watershed helps to understand which land uses might have greater influences on the source of the impairments. The following shows the land use percentages for this watershed. Grassland is considered grazingland for livestock.

p Urban Area.... 6% p Wooded area... 6% p Row Crop....48% p Grassland....45%

**Feedlots:** In Kansas, confined animal feeding operations (CAFOs) with greater than 300 animal units must register with KDHE. There are approximately 116 registered CAFOs located within HUC8 10240007 (this number, which is based on best available information, may be dated and subject to change). Waste disposal practices and waste water effluent quality are closely monitored by KDHE for these registered CAFOs to determine the need for runoff control practices or structures. Because of this monitoring, registered CAFOs are not considered a significant threat to water resources within the watershed. A portion of the State's livestock population exists on small unregistered farms. These small unregistered livestock operations may contribute a significant source of fecal coliform bacteria and nutrients, depending on the presence and condition of waste management systems and proximity to water resources.

**Wastewater Treatment Facilities:** There are approximately 3 municipal and industrial wastewater treatment facilities within the watershed (this number may be dated and subject to change). These facilities are currently regulated by KDHE under National Pollutant Discharge Elimination System (NPDES) permits. These permits determine the maximum amount of pollutants allowed to be discharged to the "waters of the State". Due to the chlorination processes involved in municipal waste treatment, these

facilities are not considered to be a significant source of fecal coliform bacteria; however they may be a significant source of nutrients.

**Septic Systems:** There are currently thousands of septic systems within the watershed and this number is increasing. When properly designed, installed, and maintained, septic systems can act as an effective means of wastewater treatment. However, poorly maintained or "failing" septic systems can leach pollutants into nearby surface waters and groundwater. The exact number of failing septic systems within the watershed is unknown; however the number may be increasing due to the current trends in suburban development. Local Environmental Protection Programs and county health departments provide excellent sources of information regarding the proper design, installation, and maintenance for septic systems.

**Wildlife:** Wildlife located throughout the watershed are not usually considered a significant source of nonpoint source pollutants. However, during seasonal migrations, concentrations of waterfowl can add significant amounts of fecal coliform bacteria and nutrients into surface water resources.

Row Crop Agriculture: As stated above, approximately 48% of the watershed's land is used for row crop agriculture. Row crop agriculture can be a significant source of nonpoint source pollution. Common pollutants from row crop agriculture include sediment, nutrients, pesticides, and fecal coliform bacteria. Many producers within the watershed regularly implement and maintain BMPs to limit the amount of nonpoint source pollutants leaving their farm. Some common BMPs include: the use of contour plowing; use of cover crops; maintaining buffer strips along field edges; and proper timing of fertilizer application.

**Urban/Suburban Runoff:** Many urban landscapes are covered by paved surfaces including roads, driveways, parking lots, and sidewalks. These surfaces are impermeable and tend to divert water into storm drains at high velocities. This increased flow velocity from urban areas can cause severe stream bank erosion in receiving water bodies. Additionally, urban and suburban runoff may carry other pollutants like petroleum hydrocarbons and heavy metals. Currently, the watershed is only about .6% urban. Limiting paved surfaces is the key to slowing urban nonpoint source pollution. The use of grass swales, open spaces, and storm water retention ponds are recommended to slow runoff in urban areas.

#### **Lakes & Wetlands**


Huc 8 10240007 is the home to a few small city and county lakes and one wetland. The majority of the lakes are used for recreational purposes such as camping and fishing but for the most part they are used for food procurement. See Attachment 2 for a map of lakes in HUC 8 10240007.

#### Designated Uses

According to the Surface Water Register, the most common designated use for this watershed's lakes & wetlands are expected aquatic life uses and food procurement.

Figure 4

#### Lake Uses in Huc 10240007

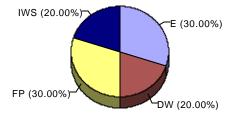


#### **TMDL/Contaminate Concerns**

Surface waters not meeting their designated uses will require total maximum daily loads (TMDL's). Figure 5 shows that 33% of the lakes/wetlands in this watershed need TMDLs.

The primary pollutant for this watershed's lakes and wetlands is insufficient water flow. This can cause the lake to have a low temperature, low dissolved oxygen, and increase pollutant concentrations.

Figure 5

Percentage of Lakes/Wetlands Needing
TMDLs

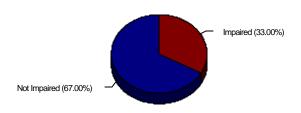


#### Groundwater

Major groundwater aquifers underlying this watershed include portions of the Glacial aquifer and alluvial aquifers of the Big Nemaha River and it's tributaries. See attachment 4 for a map of the groundwater aquifers within this watershed.

#### **Designated Uses**

There are approximately 80 groundwater wells located within the watershed. Water from these wells is used for domestic use, groundwater monitoring, public water supply and dewatering.

Figure 6

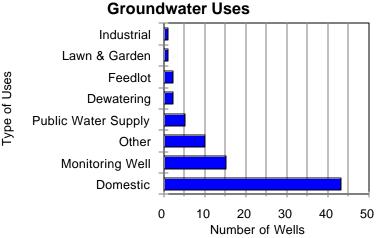

#### **Aquifer Characteristics**

**Alluvial Aquifer:** Alluvial aquifers of the Big Nemaha River exist throughout the watershed.

Alluvial aquifers provide the primary water source for many public water supplies located within the watershed. Water quality in alluvial aquifers is generally good; however nitrates, minerals, pesticides, and bacteria can be pollutant concerns.

Glacial Drift Aquifer: Portions of the Glacial Drift aquifer exist in the northwest portion of the

watershed. Water from this aquifer is often used for rural domestic water supply. Historically, water from this aquifer is very hard with nitrates being one of the

primary pollutant concerns.

#### **Potential Pollution Types and Sources**

Common groundwater pollutants include: nitrates, chloride, sulfates, bacteria and atrazine. Nitrate impaired groundwater is perhaps the most prevalent groundwater contamination problem in the State.

**Nitrate:** Nitrate is a naturally occurring compound and is an essential component of all living matter. However, high concentrations of nitrate in drinking water can cause adverse health effects including "blue baby" syndrome. Sources of nitrate include municipal waste water treatment plant discharges, runoff from livestock operations, leaching of fertilizer from urban and agricultural areas, and failing septic systems.

**Chloride:** Chloride is a naturally occurring mineral found in Kansas lakes, streams, and groundwater. In high concentrations, chloride can cause deterioration of domestic plumbing, water heaters, and municipal water works. The primary source of chloride impacted groundwater is intrusion of salt water from deeper formations, due to improperly constructed water wells which allow confined aquifers to come into contact with each other.

**Sulfates:** Sulfate is a naturally occurring mineral that can cause taste and odor problems in drinking water. Sulfates are dissolved into groundwater as the water moves through various sulfur containing rock formations.

**Bacteria:** Fecal coliform bacteria are found in the digestive systems of warm blooded animals. In the environment coliform bacteria is an indicator of potential disease causing organisms. Potential sources of bacteria contamination in groundwater include livestock facilities, septic systems, pets, and wildlife. Many wells are impacted by bacteria due to improper construction which allows water from the surface to funnel directly into the well.

**Ammonia:** Ammonia is a chemical which is toxic to fish and aquatic organisms. Sources of ammonia are livestock, septic tanks, fertilizer, municipal and industrial waste.

**TSS:** TSS stands for Total Suspended Solids which are particles such as soil, algae, and finely divided plant material suspended in water. Sources of TSS are soil erosion from cropland, stream banks, or construction sites, and municipal and industrial waste.

**VOCs:** Volatile Organic Compounds, also called purgeable organics, are components of fuels and solvents. They are ingredients in many household and industrial products. Sources of VOCs are leaking fuel storage tanks, trash dumps, and some agricultural pesticides.


**Iron:** Iron is a naturally occurring element found in the soil throughout Kansas. It is an annoyance as it has an objectionable taste, causes a red stain to porcelain fixtures and laundry, and causes plumbing irritations.


**Manganese:** Manganese is a naturally occurring element and causes an unpleasant taste in drinking water, stains porcelain and laundry, and collects deposits in plumbing. It is naturally occurring throughout the soils in the state.

### Attachment 1


Maps

## Huc -10240007- South Fork Big Nemaha Streams & Rivers

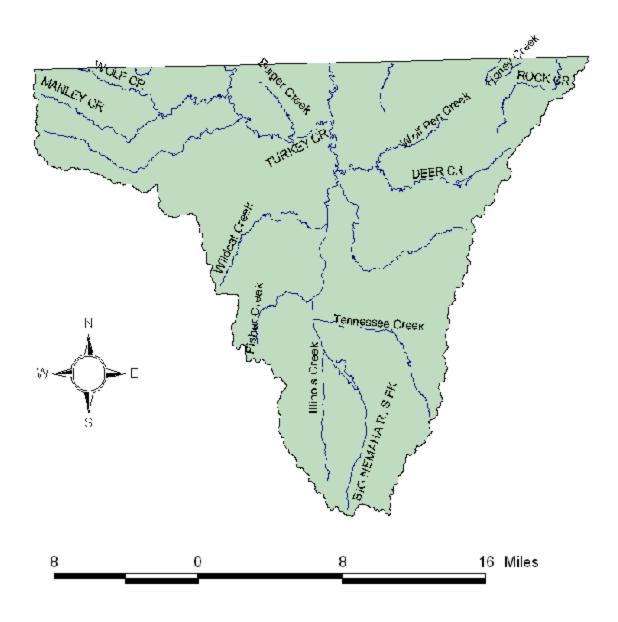

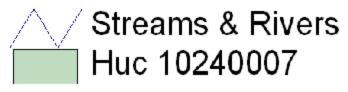


## Huc -10240007- South Fork Big Nemaha Lake Monitoring Sites

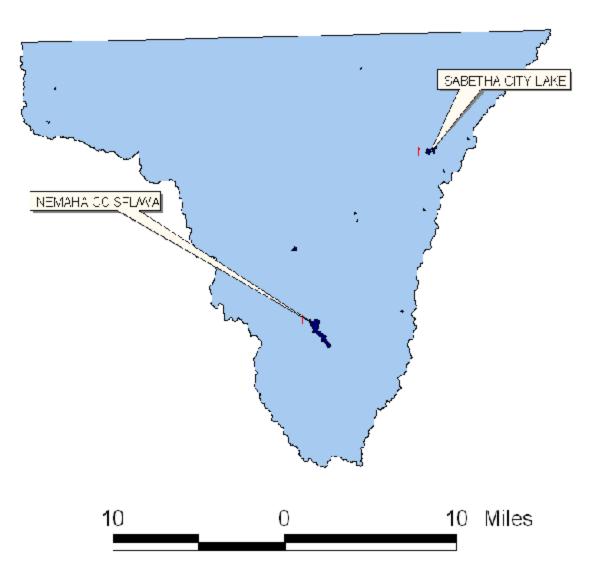

Lake Montitoring Sites
Lakes
Huc 10240007

## Huc -10240007 - South Fork Big Nemaha Watershed Boundary

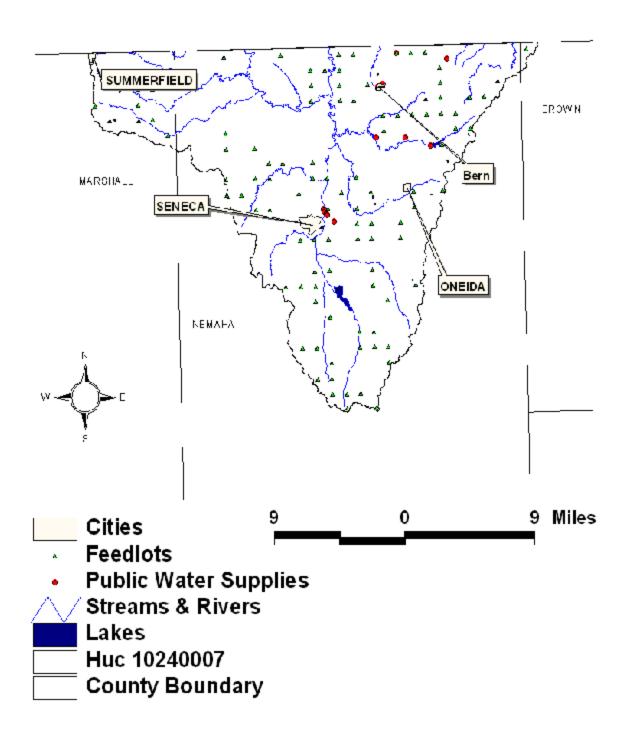

## Huc 8 10240007 South Fork Big Nemaha Groundwater Aquifers



